







TECHNICAL BULLETIN TECH-11-2023 REV-B

PSA 1.2L - 870248-5002S TURBOCHARGER REPLACEMENT

DECEMBER 2023



www.garrettmotion.com JAN. 3, 24




PSA 1.2L - 870248-5002S TURBOCHARGER REPLACEMENT

Dear Customer,


Please note that this Tech bulletin is to inform you of a mistake that was recently made in our online catalogue in specifying the wrong turbocharger PN 901680-5002S as replacement of turbochargers PN 887157-5001S & PN 870248-5002S, which is not a direct service replacement for the following reason explain below.

• TC 901680-5002S is a standalone turbocharger as it doesn't use the e-RCV valve on the compressor housing.

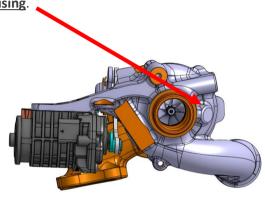

• The correct direct service replacement is as follow: TC PN 870248-5002S replaced by TC PN 887157-5001S as they are using the same e-RCV.

Also in order to do the conversion from TC 870428-5002S to 887157-5001S you will need to purchase from a PSA agent the oil pipe feed PN 98 328 034 80 & the oil drain pipe PN 98 329 260 80.

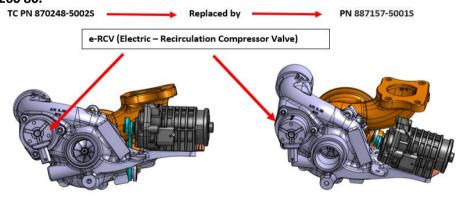

Sorry for this inconvenience and we now confirm that our online catalogue has now been corrected, hence please distribute this information to all in your company who may need it.

Best Regards,

IAM Technical Specialist support team.







www.garrettmotion.com JAN. 3, 24









www.garrettmotion.com JAN. 3, 2